




## **NO-A1 Nitric Oxide Sensor**



### Figure 1 NO-A1 Schematic Diagram

PATENTED

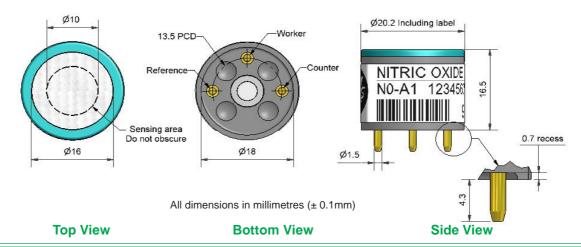

PERFORMANCE	Sensitivity Response time Zero current Resolution Range Linearity Overgas limit		nA/ppm in 50ppm NO t <sub>90</sub> (s) from zero to 50ppm NO ppm equivalent in zero air RMS noise (ppm equivalent) ppm NO limit of performance warranty ppm error at full scale, linear at zero and 50ppm NO maximum ppm for stable response to gas pulse		320 to 480 < 45 0 to +2 < 0.2 250 +15 to +25 800
LIFETIME	Zero drift		ppm equivalent change/year in lab air		< 0.3
	Sensitivity drift		% change/year in lab air, monthly test		< 5
	Operating life		months until 80% original signal (24 month warranted)		> 24
ENVIRONMENTA	LSensitivity @ -20°C		% (output @ -20°C/output @ 20°C) @ 50ppm		83 to 94
	Sensitivity @ 50°C		% (output @ 50°C/output @ 20°C) @ 50ppm		98 to 104
	Zero @ -20°C		ppm equivalent change from 20°C		< 0 to -1
	Zero @ 50°C		ppm equivalent change from 20°C		< 3 to 16
CROSS SENSITIVITY	H <sub>2</sub> S NO <sub>2</sub> CI <sub>2</sub> SO <sub>2</sub> H <sub>2</sub> CO NH <sub>3</sub> CO <sub>2</sub>	sensitivity sensitivity sensitivity sensitivity sensitivity sensitivity sensitivity	% measured gas @ 20ppm % measured gas @ 50ppm % measured gas @ 10ppm % measured gas @ 20ppm % measured gas @ 400ppm % measured gas @ 400ppm % measured gas @ 20ppm % measured gas @ 5% Vol	H <sub>2</sub> S NO <sub>2</sub> CI <sub>2</sub> SO <sub>2</sub> H <sub>2</sub> CO NH <sub>3</sub> CO <sub>2</sub>	< 30 < 5 < 15 < 3 < 0.1 < 0.1 < 0.1

#### **KEY SPECIFICATIONS**

Bias voltage	mV (working electrode potential is above ground)	+300
Temperature range	°C	-30 to 50
Pressure range	kPa	80 to 120
Humidity range	% rh continuous	15 to 90
Storage period	months @ 3 to 20°C (stored in sealed pot)	6
Load resistor	$\Omega$ (recommended)	10 to 47
Weight	g	< 6
	Pressure range Humidity range Storage period Load resistor	Temperature range $^{\circ}$ C   Pressure range   KPa   Humidity range   % rh continuous   Storage period   Load resistor $^{\circ}$ C   (recommended)



At the end of the product's life, do not dispose of any electronic sensor, component or instrument in the domestic waste, but contact the instrument manufacturer, Alphasense or its distributor for disposal instructions.

**NOTE:** all sensors are tested at ambient environmental conditions, with 10 ohm load resistor, unless otherwise stated. As applications of use are outside our control, the information provided is given without legal responsibility. Customers should test under their own conditions, to ensure that the sensors are suitable for their own requirements.





# **NO-A1 Performance Data**

#### Figure 2 Sensitivity Temperature Dependence

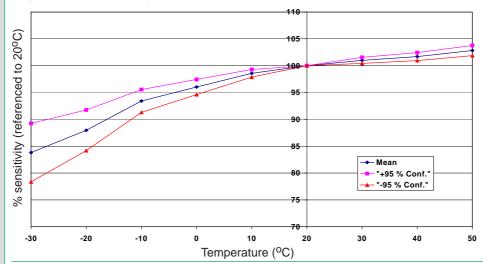


Figure 2 shows the variation in sensitivity caused by changes in temperature.

This data is taken from a typical batch of sensors. The mean and  $\pm$  95% confidence intervals are shown.

Figure 3 Zero Temperature Dependence


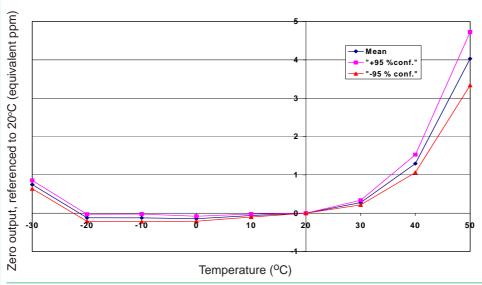


Figure 3 shows the variation in zero output caused by changes in temperature, expressed as ppm gas equivalent, referenced to zero at 20°C.

This data is taken from a typical batch of sensors. The mean and ±95% confidence intervals are shown.

Figure 4 Response Time(t<sub>90</sub>) Temperature Dependence

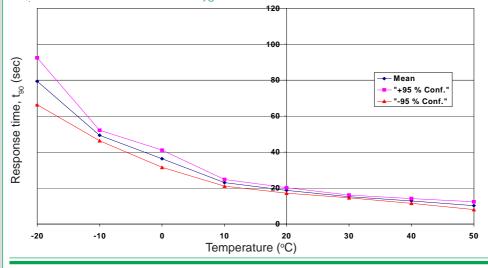

Sensor response time increases as temperature decreases. Alphasense response time  $(t_{90})$  is measured at 20°C.

For further information on the performance of this sensor, on other sensors in the range or any other subject, please contact Alphasense Ltd. For Application Notes visit "www.alphasense.com".

In the interest of continued product improvement, we reserve the right to change design features and specifications without prior notification. The data contained in this document is for guidance only. Alphasense Ltd accepts no liability for any consequential losses, injury or damage resulting from the use of this document or the information contained within. ( ©ALPHASENSE LTD ) Doc. Ref. NOA1/JUL12